

# **Release Notes**

**OMAPL137 BIOSPSP 01.30.01**

**March 10, 2010**

This page has been intentionally left blank.

---

## **IMPORTANT NOTICE**

Texas Instruments Incorporated and its subsidiaries (TI) reserve the right to make corrections, modifications, enhancements, improvements, and other changes to its products and services at any time and to discontinue any product or service without notice. Customers should obtain the latest relevant information before placing orders and should verify that such information is current and complete. All products are sold subject to TI's terms and conditions of sale supplied at the time of order acknowledgment.

TI warrants performance of its hardware products to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are used to the extent TI deems necessary to support this warranty. Except where mandated by government requirements, testing of all parameters of each product is not necessarily performed.

TI assumes no liability for applications assistance or customer product design. Customers are responsible for their products and applications using TI components. To minimize the risks associated with customer products and applications, customers should provide adequate design and operating safeguards.

TI does not warrant or represent that any license, either express or implied, is granted under any TI patent right, copyright, mask work right, or other TI intellectual property right relating to any combination, machine, or process in which TI products or services are used. Information published by TI regarding third-party products or services does not constitute a license from TI to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

Reproduction of information in TI data books or data sheets is permissible only if reproduction is without alteration and is accompanied by all associated warranties, conditions, limitations, and notices. Reproduction of this information with alteration is an unfair and deceptive business practice. TI is not responsible or liable for such altered documentation.

Resale of TI products or services with statements different from or beyond the parameters stated by TI for that product or service voids all express and any implied warranties for the associated TI product or service and is an unfair and deceptive business practice. TI is not responsible or liable for any such statements.

Mailing Address:  
Texas Instruments  
Post Office Box 655303  
Dallas, Texas 75265

Copyright ©. 2009, Texas Instruments Incorporated

This page has been intentionally left blank.

---

**TABLE OF CONTENTS**


---

<b>1</b>	<b>Introduction</b> .....	<b>7</b>
1.1	Release Category .....	7
1.2	Text Conventions .....	7
<b>2</b>	<b>Out-of-Box Contents</b> .....	<b>8</b>
<b>3</b>	<b>Dependencies</b> .....	<b>9</b>
<b>4</b>	<b>Drivers/Components for this release</b> .....	<b>10</b>
4.1	Changes from previous release (Version 01.30.00).....	10
4.2	Other changes .....	10
<b>5</b>	<b>Known Issues</b> .....	<b>10</b>
<b>6</b>	<b>Limitations</b> .....	<b>11</b>
6.1	I2C (DSP/BIOS™) Device Driver .....	11
6.2	SPI (DSP/BIOS™) Device Driver.....	11
6.3	UART (DSP/BIOS™) Device Driver .....	11
6.4	McASP (DSP/BIOS™) Device Driver .....	11
6.5	LCDC Raster Controller (DSP/BIOS™) Driver .....	11
6.6	Aic3106 Codec driver (DSP/BIOS™) .....	11
6.7	EVM OMAPL137 Limitation.....	12
<b>7</b>	<b>Fixed in this release</b> .....	<b>13</b>
7.1	AUDIO (DSP/BIOS™) Device Driver .....	13
7.2	MCASP (DSP/BIOS™) Device Driver.....	13
7.3	EVM Initialization library .....	13
7.4	MMCSDB (DSP/BIOS™) Device Driver.....	13
7.5	CSLR files.....	13
<b>8</b>	<b>Special notes</b> .....	<b>14</b>
<b>9</b>	<b>Technical Support</b> .....	<b>15</b>
<b>10</b>	<b>Release History</b> .....	<b>16</b>
10.1	Release 01.30.00 .....	16
10.2	Release 01.30.00.07.....	19
10.3	Release 01.30.00.06.....	19
10.4	Release 01.30.00.05.....	23
10.5	Release 01.30.00.04.....	25
10.6	Release 01.30.00.03.....	27
10.7	Release 01.30.00.02.....	29
10.8	Release 01.20.00 .....	33
10.9	Release 01.20.00.08.....	34

---

10.10	Release 01.20.00.07.....	38
10.11	Release 01.20.00.06.....	40
10.12	Release 01.20.00.05.....	40
10.13	Release 01.20.00.04.....	45
10.14	Release 01.20.00.03.....	46
10.15	Release 01.20.00.02.....	47

## 1 Introduction



This PSP Package serves as fundamental software platform for development, deployment and execution of application software on OMAPL137 based platform. PSP abstracts the functionality provided by the OMAPL137.

This PSP package is intended for the DSP that runs DSP/BIOS™ (user guide that came along with this release details the system requirements)

### 1.1 Release Category

This PSP release versioned 01.30.01 is GA release with combined support for OMAPL137, C6747, C6748 and OMAPL138. Please refer to section [Drivers/Components for this release](#) for details of this release.

### 1.2 Text Conventions

	<p>This bullet indicates important information. Please read such text carefully.</p>
	<p>This bullet indicates additional information.</p>

---

## 2 Out-of-Box Contents

BIOSPSP\_01\_30\_xx\_xx\_Setup.exe contains following:

1.	<ul style="list-style-type: none"> <li>- Source code for driver and other necessary abstractions.</li> <li>- Project files (DSP/BIOS™), CCS3.3 / CCS 4 build files</li> <li>- The above mentioned items are located inside the &lt;installation dir&gt;\pspdriers_01_30_xx_xx\packages\ti directory</li> <li>- Please refer to the user guide for introduction to the folder structure</li> <li>- Please note that the CCS setup files and GEL files are <u>NOT</u> provided with this release and this would be available with latest CCSv3 releases or from EVM manufacturer.</li> </ul>
2.	Release Notes (this document) providing an overview of this release.
3.	User Guide that provides information on package usage and each driver's usage.
4.	Datasheet that provides resource usage and performance information of the each driver
5.	Doxygen based driver API (generated) documentation for all the drivers inside package.



### **3 Dependencies**

- CCS 3.3.24 or higher with service release 10
- CCS 4.0.0.16 or higher (optional)
- OMAPL137 EVM
- DSP/BIOS™ 5.41.03.17
- Code Generation Tools 6.1.9
- EDMA3 product version 01.11.00.03
- ERTFS File System - This is required if one wants to use the filesystem on Storage Media. Same can be downloaded from following link:

[http://software-dl.ti.com/dsps/dsps\\_registered\\_sw/sdo\\_sb/targetcontent//bios\\_file\\_system/index.html](http://software-dl.ti.com/dsps/dsps_registered_sw/sdo_sb/targetcontent//bios_file_system/index.html)

## **4 Drivers/Components for this release**

This section lists the driver / components that are delivered as part of this release.

- DSP/BIOS™ 5.41.xx Drivers
  - Serial (UART, I2C and SPI)
  - Audio (McASP, AUDIO interface and CODEC)
  - Storage (Block media, MMCSD and NAND)
  - LCDC Raster and LIDD drivers
  - GPIO driver
  - PSC (that helps to turn the clock on/off for the modules)
  - rCSL header files and examples for rCSL usage
- Sample applications that demonstrate the use of above drivers

Please note that at this point of time the drivers does not have any abstraction for the OS APIs and they use the OS (DSP/BIOS™ 5.41.xx) inside the drivers.

### **4.1 Changes from previous release (Version 01.30.00)**

- 1) This is the GA release for BIOSPSP with combined support for EVM OMAPL138, OMAPL137, C6748 and C6747
- 2) This release is for support on DSP/BIOS™ 5.41.03.17.
- 3) KICK0 and KICK1 register writes has been removed from the evmInit library. Please see the **section 1.4** of the user guide for more details.
- 4) Please see the "Fixed in this release" for details on IR's fixed/implemented

### **4.2 Other changes**

None

## **5 Known Issues**

---

## **6 Limitations**

### **6.1 I2C (DSP/BIOS™) Device Driver**

- Loopback is not supported
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMR register)
- I2C driver does not support slave mode of operation in polled mode. Only interrupt and DMA interrupt mode of operation are supported. The slave mode of operation is tested successfully 100,200 and 400 kHz I2C clock frequency.
- (a) I2C slave application need to take care of the data (application level) protocol on when and what to receive and send by/from slave side. (b) This driver provides a generic bus communication path for slave. (c) Application protocol also needs to consider the latency caused by software slave implementation. (d) The driver does not support "0" no of byte transfer and the slave driver would not function properly if master issues a STOP condition immediately after a START condition.

### **6.2 SPI (DSP/BIOS™) Device Driver**

- Slave mode of operation is tested at 2MHz. Because of the wired EVM to EVM connectivity, signal integrity was not good to test on further higher frequencies.
- (a) Application protocol also needs to consider the latency caused by software slave implementation. (b) The driver does not support "0" no of byte transfer.

### **6.3 UART (DSP/BIOS™) Device Driver**

- Character timeout can be detected only when
  - the RX FIFO threshold level is NOT equal to 1
  - the number of characters sent by the transmitter is a not a multiple of the RX FIFO threshold
  - In FIFO mode and cannot be used in non-FIFO mode
  - In interrupt mode of operation
  - Please refer to the section 2.5.3.1 of UART Peripheral User's Guide SPRUFM6A

### **6.4 McASP (DSP/BIOS™) Device Driver**

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

### **6.5 LCDC Raster Controller (DSP/BIOS™) Driver**

- Slight flickering is observed on the display when the image is displayed by the sample application.
- When the palette loaded interrupts are enabled, then the raster interrupts stop arriving after a random time and hence the application might hang. The workaround is to disable the palette loaded interrupt.

### **6.6 Aic3106 Codec driver (DSP/BIOS™)**

The Aic31 driver currently supports only one codec instance.

**6.7 EVM OMAPL137 Limitation**

None

---

## 7 Fixed in this release

### 7.1 AUDIO (DSP/BIOS™) Device Driver

- **CQ SDOCM00066639:** Some of the Audio interface driver control commands fail. The Audio driver was passing a pointer to the user argument instead of the command argument. This has been fixed.

**Files changed:** ti\pspiom\platforms\evmOMAPL137\audio\src\Audio.c

### 7.2 MCASP (DSP/BIOS™) Device Driver

- **CQ SDOCM00066214:** Memory leak was observed in the McASP driver. During the device deletion, Mcasp driver is not deleting the SWI created earlier. This has been fixed.

**Files changed:** ti\pspiom\mcasp\src\Mcasp.c

### 7.3 EVM Initialization library

- **CQ SDOCM00067534:** KICK register usage from the BIOSPSP application should be removed in case of ARM+DSP devices. This is because unlocking of the KICK registers by multiple entities can lead to race conditions.

**Files changed:** evmInit library sources.

- **CQ SDOCM00067519:** The configuring of the pinmux registers should only modify the required bits in the PINMUX register rather than modifying the entire register.

**Files changed:** evmInit library sources.

- **CQ SDOCM00065612:** The CCS4 project build configuration did not contain BIOS\_PWRM\_ENABLE compiler pre-definition. This was causing compilation failure. This has been corrected.

**Files changed:** ti\pspiom\platforms\evmOMAPL137\build\ccs4\cdtbuild

### 7.4 MMCSA (DSP/BIOS™) Device Driver

- **CQ SDOCM00066212:** The mmcsa driver deinit sequence was not deleting the queues creating during init sequence. This has been corrected.

**Files changed:** ti\pspiom\mmcsa\src\ddc\_mmcsa.c

- **CQ SDOCM00064721:** The write protect status query was failing randomly on some cards. This was because one of the status variables was not being updated properly. This has been corrected.

**Files changed:** ti\pspiom\mmcsa\src\ddc\_mmcsa.c

### 7.5 CSLR files

- **CQ SDOCM00060340:** Redefinition warnings found in the CSLR files.

**Files changed:** csldr\_ehrpwm.h

- **CQ SDOCM00065665:** Improper characters found in the CSLR file leading to failure in compilation.

**Files changed:** csldr\_ecap.h

## **8 Special notes**

- Please refer the user guide for installation, build instructions and tool version information.
- The resource allocation is the responsibility of application (system integrator)

## **9 Technical Support**

To submit questions about issues with this BIOSPSP drivers release please go to the external forums at <http://community.ti.com/> or to <http://support.ti.com> .

---

## 10 Release History

### 10.1 Release 01.30.00

This was a GA release.

#### 10.1.1 Changes from previous release (Version 01.30.00.07)

- 1) This is the GA release for BIOSPSP with combined support for EVM OMAPL138, OMAPL137, C6748 and C6747
- 2) This release is for support on DSP/BIOS™ 5.41.02.14.
- 3) This release contains support for building driver and application via CCSv4.
- 4) This release contains support for LPSC based clock gating (the PSC driver has undergone changes to support this feature), DVFS and SLEEP modes. Please note that the DVFS and SLEEP modes support is for OMAPL138 and C6748 only.
- 5) The device parameters (devParams to mdBindDev) contain changes (new parameters) to support DVFS and SLEEP modes. Legacy users migrating to this version of BIOSPSP might require recompiling the driver to absorb these changes. Please refer to the "Power management" section in user guide for more details
- 6) Please see the "Fixed in this release" for details on IR's fixed/implemented

#### 10.1.2 Other changes

None

#### 10.1.3 Known Issues

##### 10.1.3.1 MMC/SD (DSP/BIOS™) Driver

- Card temporary write protect feature does not work in "debug" profile on ElitePro (SD 2GB High Speed) and Patriot (SD 1GB) cards. This issue is being investigated  
**CQ: SDOCM00064721**  
**Workaround:** None.

#### 10.1.4 Limitations

##### 10.1.4.1 I2C (DSP/BIOS™) Device Driver

- Loopback is not supported
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMR register)
- I2C driver does not support slave mode of operation in polled mode. Only interrupt and DMA interrupt mode of operation are supported. The slave mode of operation is tested successfully 100,200 and 400 kHz I2C clock frequency.
- (a) I2C slave application need to take care of the data (application level) protocol on when and what to receive and send by/from slave side. (b) This driver provides a generic bus communication path for slave. (c) Application protocol also needs to consider the latency caused by software slave implementation. (d) The driver



does not support "0" no of byte transfer and the slave driver would not function properly if master issues a STOP condition immediately after a START condition.

#### 10.1.4.2 *SPI (DSP/BIOS™) Device Driver*

- Slave mode of operation is tested at 2MHz. Because of the wired EVM to EVM connectivity, signal integrity was not good to test on further higher frequencies.
- (a) Application protocol also needs to consider the latency caused by software slave implementation. (b) The driver does not support "0" no of byte transfer.

#### 10.1.4.3 *UART (DSP/BIOS™) Device Driver*

- Character timeout can be detected only when
  - the RX FIFO threshold level is NOT equal to 1
  - the number of characters sent by the transmitter is a not a multiple of the RX FIFO threshold
  - In FIFO mode and cannot be used in non-FIFO mode
  - In interrupt mode of operation
  - Please refer to the section 2.5.3.1 of UART Peripheral User's Guide SPRUFM6A

#### 10.1.4.4 *McASP (DSP/BIOS™) Device Driver*

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

#### 10.1.4.5 *LCDC Raster Controller (DSP/BIOS™) Driver*

- Slight flickering is observed on the display when the image is displayed by the sample application.
- When the palette loaded interrupts are enabled, then the raster interrupts stop arriving after a random time and hence the application might hang. The workaround is to disable the palette loaded interrupt.

#### 10.1.4.6 *Aic3106 Codec driver (DSP/BIOS™)*

The Aic31 driver currently supports only one codec instance.

### 10.1.5 **EVM OMAPL137 Limitation**

None

### 10.1.6 **Fixed in this release**

#### 10.1.6.1 *UART (DSP/BIOS™) Driver*

- **CQ SDOCM00060680:** Loopback read-write test would hang in interrupt mode when tested using multiple task. This issue was because the ISR was not updating the interrupt status appropriately. This has been fixed.

**Files changed:** ti\pspiom\uart\src\Uart.c

- **CQ SDOCM00064683:** In interrupt mode of operation the character timeout interrupt was not handled correctly. This has been changed to abort the current packet with the status updated as ETIMEOUT and the size filed updated appropriately.

**Files changed:** ti\pspiom\uart\src\Uart.c

- **CQ SDOCM00064682:** In DMA\_INTERRUPT mode of operation when overrun errors occurred, the driver would throw away the error bytes and continue with the packet. However, this is not the desired behavior in case of errors. The packet should be aborted with proper error status and size updated.

**Files changed:** ti\pspiom\uart\src\Uart.c

- **CQ SDOCM00063092:** The uartMdDeleteChan() function was not properly updating the LPSC turn off state. This has been fixed.

**Files changed:** ti\pspiom\uart\src\Uart.c

#### 10.1.6.2 SPI (DSP/BIOS™) Driver

- **CQ SDOCM00064944:** Junk characters in the name mangling protection guarding condition in SPI driver header file would emit compilation errors in C++ domain. This has been corrected.

**Files changed:** ti\pspiom\spi\Spi.h

- **CQ SDOCM00062392:** The cancel pending IOCTL would fail because the active IOP and active channel variables were not updated appropriately after every transfer was completed. This has been fixed.

**Files changed:** ti\pspiom\spi\src\Spi.c

#### 10.1.6.3 MMCSDB (DSP/BIOS™) Driver

- **CQ SDOCM00062388:** The driver did not disable the PSC during de-initialization. This has been fixed.

**Files changed:** ti\pspiom\mmcsd\src\ddc\_mmcsd.c

#### 10.1.6.4 NAND (DSP/BIOS™) Driver

- **CQ SDOCM00062388:** The driver does not disable the PSC during de-initialization. This has been fixed.

**Files changed:** ti\pspiom\nand\src\llc\_nand.c

#### 10.1.6.5 I2C (DSP/BIOS™) Device Driver

- **CQ SDOCM00064536:** After cancel pending IO IOCTL was called, the next IO would sometimes hang, because the current IO would be aborted, in the IOCTL context itself, without bothering about the proper conditions on the bus. This has been corrected by only setting the cancel flag in the IOCTL and the rest of the operation during the completion interrupt for the current IO.

**Files changed:** ti\pspiom\i2c\src\I2c.c

- **CQ SDOCM00063690:** The channel handle inside the interrupt handle after an iteration of processing was not being updated with the "currentActiveChannel" variable. This was needed because during iteration, this could have changed due to IO completion. This was fixed in the driver.

**Files changed:** ti\pspiom\i2c\src\I2c.c

#### 10.1.6.6 McASP (DSP/BIOS™) Device Driver

- **CQ SDOCM00062991:** The audio would not play after using the channel reset IOCTL. This was because the IOCTL was resetting the device to default values. This has been fixed to reset only the channel data structures and channel states.

**Files changed:** ti\pspiom\mcasep\src\Mcasep\_ioctl.c

- **CQ SDOCM00063254:** In non-loopjob mode, during channel deletion, the driver would attempt to restart the EDMA and clocks, which would generate error interrupts. However, the clocks and EDMA should be restarted only in case a new packet is submitted in non-loopjob mode. This has been fixed.

**Files changed:** ti\pspiom\mcasep\src\Mcasep.c

#### 10.1.6.7 GPIO (DSP/BIOS™) Device Driver

- **CQ SDOCM00063717:** The index used for bank registers array was wrong. This has been fixed.

**Files changed:** ti\pspiom\gpio\src\Gpio.c

- **CQ SDOCM00063968:** The GPIO open call now prevents against multiple opens used in a system.

**Files changed:** ti\pspiom\gpio\src\Gpio.c

#### 10.1.6.8 rCSL changes

- **CQ SDOCM00064393:** The rCSL header files was not properly including the closing the C++ guarding. This has been fixed.

#### 10.1.6.9 PSC (DSP/BIOS™) Device Driver

- **CQ SDOCM00064394:** The PSC driver project was not including "-dNDEBUG" option in the release mode. This has been fixed.

**Files changed:** ti\pspiom\psc\build\

#### 10.1.6.10 Input Parameter validation

- **CQ SDOCM00059660:** The input parameter checking in the drivers is guarded by PSP\_DISABLE\_INPUT\_PARAMETER\_CHECK (for interface functions only). This implementation has been optimized.

**Files changed:** all driver files

#### 10.1.6.11 Compilation errors

- **CQ SDOCM00062652:** Compilation of drivers without xxx\_EDMA\_ENABLE option would result in errors. This issue has been fixed.

**Files changed:** I2c, Uart and Spi driver files

## 10.2 Release 01.30.00.07

This was an internal release

## 10.3 Release 01.30.00.06

This was the BETA release

### 10.3.1 Changes from previous release (Version 01.30.00.05)

- 1) This is Beta release as part of the combined support for C6747, OMAPL137, C6748 and OMAPL138.
- 2) This release is for support on DSP/BIOS™ version 5.41.00.06.

- 3) This release contains support for building driver and application via CCSv4.
- 4) This release contains support for LPSC based clock gating. The PSC driver has undergone changes to support this feature.
- 5) Please see the "Fixed in this release" for details on IR's fixed/implemented

### 10.3.2 Known Issues

#### 10.3.2.1 MISRA C

- MISRA C check has not been run on all the components in this release.

#### 10.3.2.2 Instrumentation (all components)

- **CQ SDOCM00051988:** Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_ DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation.

**Workaround:** None.

#### 10.3.2.3 UART (DSP/BIOSTM) Driver

- **CQ SDOCM00059982:** When the RXFIFO threshold is greater than 4 and the baud rate is greater than or equal to 115200 baud, data received contains repeated characters and does not match the transmitted characters. This issue is being investigated.

**Workaround:** Use polled or interrupt mode of operation.

- **CQ SDOCM00060680:** Loopback read-write test hangs for interrupt mode when tested using multiple task. This issue is being investigated.

**Workaround:** None.

#### 10.3.2.4 McASP (DSP/BIOSTM) Driver

- **CQ SDOCM00059897:** The driver is not working as expected in non-loop job mode. Data loss is observed in some cases. This issue is being investigated.

**Workaround:** None.

#### 10.3.2.5 SPI (DSP/BIOSTM) Driver

- **CQ SDOCM00060205:** BIT errors are seen in interrupt and polled modes of operation when the SPI output frequency is greater 30 MHz.

**Workaround:** Use DMA mode of operation

- **CQ SDOCM00062392:** The cancel pending IOCTL fails because it does not update the active IOP and active channel variables appropriately. This will be fixed in the next releases.

**Workaround:** None

#### 10.3.2.6 MMCSDB (DSP/BIOSTM) Driver

- **CQ SDOCM00062388:** The driver does not disable the PSC during de-initialization. This will be fixed in the next release

**Workaround:** None.

---

### 10.3.2.7 *NAND (DSP/BIOSTM) Driver*

- **CQ SDOCM00062388:** The driver does not disable the PSC during de-initialization. This will be fixed in the next release

**Workaround:** None.

### 10.3.3 Limitations

#### 10.3.3.1 *I2C (DSP/BIOS™) Device Driver*

- Loopback is not supported in interrupt mode
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMDR register)
- I2C driver does not support slave mode of operation in polled mode. Only interrupt and DMA interrupt mode of operation are supported. The slave mode of operation is tested successfully 100,200 and 400 kHz I2C clock frequency.
- (a) I2C slave application need to take care of the data (application level) protocol on when and what to receive and send by/from slave side. (b) This driver provides a generic bus communication path for slave. (c) Application protocol also needs to consider the latency caused by software slave implementation. (d) The driver does not support "0" no of byte transfer and the slave driver would not function properly if master issues a STOP condition immediately after a START condition.

#### 10.3.3.2 *SPI (DSP/BIOS™) Device Driver*

- Slave mode of operation is tested at 2MHz. Because of the wired EVM to EVM connectivity, signal integrity was not good to test on further higher frequencies.
- (a) Application protocol also needs to consider the latency caused by software slave implementation. (b) The driver does not support "0" no of byte transfer.

#### 10.3.3.3 *McASP (DSP/BIOS™) Device Driver*

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

#### 10.3.3.4 *Aic3106 Codec driver (DSP/BIOS™)*

The Aic31 driver currently supports only one codec instance.

#### 10.3.3.5 *EVM OMAPL137 Limitation*

None

### 10.3.4 Fixed in this release

#### 10.3.4.1 *Error handling*

- **CQ SDOCM00061546:** Drivers were not updating the IOM packet status appropriately before returning the packet to the upper layer. This has been fixed.

#### 10.3.4.2 *UART (DSP/BIOSTM) Driver*

- **CQ SDOCM00060841:** When the RXFIFO threshold was set to 1 at baud rate of 115200 baud RX overrun errors were observed. This was because there were remnant bytes in the FIFO due to previous irrelevant transmits from the

transmitter which caused continuous overruns. In cases where there are chances that the RX FIFO might contain remnant bytes from previous transfer, it would be good to start with RX reset via the RXFIFO reset IOCTL provided.

**Files modified: None**

- **CQ SDOCM00058955:** The transmission at 2400 baud rate would fail in interrupt mode. This was because of lower values of trial counts in the interrupt handler to check for completion of previous transfer before the write of next character. This count has been increased (Uart\_TRANSMITEMPTY\_TRIALCOUNT defined in Uart.h).

**Files modified: ti\pspiom\uart\Uart.h**

10.3.4.3 *I2C (DSP/BIOSTM) Driver*

- **CQ SDOCM00058961:** I2C read/write to the I/O expander on the EVM would fail inconsistently in polled mode of operation. This was because the polled mode transfer function would not wait for the previous transfer to be completed and wait for the bus to be ready for next transfer. This check has been added..

**Files modified: ti\pspiom\i2c\src\I2c.c**

- **CQ SDOCM00060228:** Slave mode of operation of I2C drivers are tested on the EVM.

**Files modified: ti\pspiom\i2c\src\I2c.c**

- **CQ SDOCM00060486:** Set Bit rate/Set own address IOCTL test cases would fail for interrupt and DMA mode. This was because the pending IO flag was not reset after the completion of the current IOP. This has been fixed.

**Files modified: ti\pspiom\i2c\src\I2c.c**

- **CQ SDOCM00061786:** I2C Read-Write test would fail after cancel pending ioctl command is issued for interrupt and DMA modes. This was because the next channel was not scheduled for transfer. This has been fixed.

**Files modified: ti\pspiom\i2c\src\I2c.c**

10.3.4.4 *McASP (DSP/BIOSTM) Driver*

- **CQ SDOCM00059895:** The IOCTLs for non-loopjob mode have been tested.

**Files modified: ti\pspiom\mcasp\src\Mcasp.c**

- **CQ SDOCM00059968:** The start and stop IOCTLs were not working as expected. IOP handling during the state machine STOP condition was not correct. State machine STOP condition was not being considered by the driver.

**Files modified: ti\pspiom\mcasp\src\Mcasp.c**

- **CQ SDOCM00059969:** The IOCTLs for MUTE and Un-MUTE were not working as expected. Calculation of the EDMA parameters during the Mute of the channel is not correct. This has been fixed.

**Files modified: ti\pspiom\mcasp\src\Mcasp.c**

**ti\pspiom\mcasp\src\Mcasp\_edma.c**

10.3.4.5 *NAND (DSP/BIOSTM) Driver*

- **CQ SDOCM00059984:** Data integrity (mismatch) errors are seen when the driver is accessed via file system. This is observed very randomly. This issue is because of wrong ECC calculation method used inside the nand driver.

**Files modified:** ti\pspiom\nand\src\llc\_nand.c

- **CQ SDOCM00060750:** Throughput numbers are observed to be low on the EVM. This issue is because wrong CS is used inside the driver to update the timing parameter.

**Files modified:** ti\pspiom\nand\src\llc\_nand.c

10.3.4.6 *MMCS D (DSP/BIOSTM) Driver*

- **CQ SDOCM00060892:** During performance measurements on SanDisk™ 4GB card, it is observed that the read may fail. This is because of card timeout, so the timeout is increased.

**Files modified:** ti\pspiom\mmcsd\src\ddc\_mmcsd.c

**10.4 Release 01.30.00.05**

This was an EA release

**10.4.1 Changes from previous release (Version 01.30.00.05)**

- 1) This is an EA release as part of the combined support for C6747, OMAPL137, C6748 and OMAPL138.
- 2) This release is for support on DSP/BIOS™ version 5.33.06.
- 3) A new parameter is added for Character LCD display configuration structure. Please refer to the user guide for more details.
- 4) Please see the "Fixed in this release" for details on IR's fixed/implemented

**10.4.2 Known Issues**

10.4.2.1 *MISRA C*

- MISRA C check has not been run on all the components in this release.

10.4.2.2 *Instrumentation (all components)*

- Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation. **CQ SDOCM00051988**

**Workaround:** None.

10.4.2.3 *LCDC Raster Controller (DSP/BIOS™) Driver*

- Slight flickering is observed on the display when the image is displayed by the sample application. This issue is being analyzed. **CQ SDOCM00055419**

**Workaround:** None

---

#### 10.4.2.4 *UART (DSP/BIOS™) Driver*

- The write from the UART to the serial console fails at 2400 baud in interrupt mode. This issue is being analyzed. **CQ SDOCM00058955**

**Workaround:** Use DMA or polled mode for data transfer

- When the RXFIFO threshold is greater than 4 and the baudrate is greater than or equal to 115200 baud, data received contains repeated characters and does not match the transmitted characters. This issue is being investigated. **CQ SDOCM00059982**

**Workaround:** Use polled or interrupt mode of operation.

#### 10.4.2.5 *McASP (DSP/BIOS™) Driver*

- The start and stop IOCTLs are not working as expected. The audio does not appropriately stop and restart at the issue of these commands. This issue is being investigated. **CQ SDOCM00059968**
- The IOCTLs for MUTE and Un-MUTE are not working as expected. The audio does not appropriately mute and restart at the issue of these commands. This issue is being investigated. **CQ SDOCM00059969**
- The IOCTL commands are not tested in non-loopjob mode. This will be taken up in forthcoming releases. **CQ SDOCM00059895**
- The driver is not working as expected in non-loopjob mode. Data loss is observed in some cases. This issue is being investigated. **CQ SDOCM00059897**
- The cache settings for audio sample application need changes to improve the performance of audio sample application. Currently, the L2 cache is not being used and the external memory is not placed as cache-able memory. **CQ: SDOCM00060198**

### 10.4.3 Limitations

#### 10.4.3.1 *I2C (DSP/BIOS™) Device Driver*

- Loopback is not supported in interrupt mode
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMR register)
- I2C driver does not support slave mode of operation in polled mode. Only interrupt and DMA interrupt mode of operation are supported. The slave mode of operation is tested successfully 100,200 and 400 kHz I2C clock frequency.
- (a) I2C slave application need to take care of the data (application level) protocol on when and what to receive and send by/from slave side. (b) This driver provides a generic bus communication path for slave. (c) Application protocol also needs to consider the latency caused by software slave implementation. (d) The driver does not support "0" no of byte transfer and the slave driver would not function properly if master issues a STOP condition immediately after a START condition.

#### 10.4.3.2 *SPI (DSP/BIOS™) Device Driver*

- Slave mode of operation is tested at 2MHz. Because of the wired EVM to EVM connectivity, signal integrity was not good to test on further higher frequencies.



- (a) Application protocol also needs to consider the latency caused by software slave implementation. (b) The driver does not support "0" no of byte transfer.

#### 10.4.3.3 *McASP (DSP/BIOS™) Device Driver*

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

#### 10.4.3.4 *Aic3106 Codec driver (DSP/BIOS™)*

The Aic31 driver currently supports only one codec instance.

#### 10.4.3.5 *EVM OMAPL137 Limitation*

None

### 10.5 **Release 01.30.00.04**

This was an internal release

#### 10.5.1 **Changes from previous release (Version 01.30.00.03)**

- 1) This is an engineering release as part of the combined support for C6747, OMAPL137, C6748 and OMAPL138.
- 2) This release is for support on DSP/BIOS™ version 5.33.06.
- 3) Please see the "Fixed in this release" for details on IR's fixed/implemented

#### 10.5.2 **Known Issues**

##### 10.5.2.1 *MISRA C*

- MISRA C check has not been run on all the components in this release.

##### 10.5.2.2 *Instrumentation (all components)*

- Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation. **CQ SDOCM00051988**

**Workaround:** None.

##### 10.5.2.3 *LCDC Raster Controller (DSP/BIOS™) Driver*

- Slight flickering is observed on the display when the image is displayed by the sample application. This issue is being analyzed. **CQ SDOCM00055419**

**Workaround:** None

##### 10.5.2.4 *UART (DSP/BIOS™) Driver*

- The write from the UART to the serial console fails at 2400 baud in interrupt mode. This issue is being analyzed. **CQ SDOCM00058955**

**Workaround:** Use DMA or polled mode for data transfer

- When the RXFIFO threshold is greater than 4 and the baudrate is greater than or equal to 115200 baud, data received contains repeated characters and does not

match the transmitted characters. This issue is being investigated. **CQ SDOCM00059982**

**Workaround:** Use polled or interrupt mode of operation.

#### 10.5.2.5 *McASP (DSP/BIOS™) Driver*

- The start and stop IOCTLs are not working as expected. The audio does not appropriately stop and restart at the issue of these commands. This issue is being investigated. **CQ SDOCM00059968**
- The IOCTLs for MUTE and Un-MUTE are not working as expected. The audio does not appropriately mute and restart at the issue of these commands. This issue is being investigated. **CQ SDOCM00059969**
- The IOCTL commands are not tested in non-loopjob mode,. This will be taken up in forthcoming releases. **CQ SDOCM00059895**
- The driver is not working as expected in non-loopjob mode. Data loss is observed in some cases. This issue is being investigated. **CQ SDOCM00059897**
- The cache settings for audio sample application need changes to improve the performance of audio sample application. Currently, the L2 cache is not being used and the external memory is not placed as cache-able memory. **CQ: SDOCM00060198**

#### 10.5.2.6 *NAND (DSP/BIOS™) Driver*

- Data integrity (mismatch) errors are seen when the driver is accessed via file system. This is observed very randomly. This is however not observed when driver is accessed in RAW mode. This issue is being analyzed. **CQ SDOCM00059984**

**Workaround:** None

### 10.5.3 Limitations

#### 10.5.3.1 *I2C (DSP/BIOS™) Device Driver*

- Loopback is not supported in interrupt mode
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMDR register)
- I2C driver does not support slave mode of operation in polled mode. Only interrupt and DMA interrupt mode of operation are supported. The slave mode of operation is tested successfully 100,200 and 400 kHz I2C clock frequency.
- (a) I2C slave application need to take care of the data (application level) protocol on when and what to receive and send by/from slave side. (b)This driver provides a generic bus communication path for slave. (c) Application protocol also needs to consider the latency caused by software slave implementation. (d) The driver does not support "0" no of byte transfer and the slave driver would not function properly if master issues a STOP condition immediately after a START condition.

#### 10.5.3.2 *SPI (DSP/BIOS™) Device Driver*

- Slave mode of operation is tested at 2MHz. Because of the wired EVM to EVM connectivity, signal integrity was not good to test on further higher frequencies.

- (a) Application protocol also needs to consider the latency caused by software slave implementation. (b) The driver does not support "0" no of byte transfer.

#### 10.5.3.3 McASP (DSP/BIOS™) Device Driver

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

#### 10.5.3.4 Aic3106 Codec driver (DSP/BIOS™)

The Aic31 driver currently supports only one codec instance.

#### 10.5.3.5 EVM OMAPL137 Limitation

None

### 10.5.4 Fixed in this release

#### 10.5.4.1 LCDC LIDD (DSP/BIOS™) Driver

- **CQ SDOCM00060837:** The LCDC character driver would always configure and initialize the CS0 chip select during channel creation. This has been corrected by adding a parameter to the channel parameters to specify the chip select which needs to be used for the channel and hence appropriately configuring and initializing the device on that chip select.

**Files modified:** ti\pspiom\lcdclidd\Lidd.h and ti\pspiom\lcdclidd\src\Lidd.c

## 10.6 Release 01.30.00.03

This was the EA release with combined support for C6748, C6747, OMAPL138 and OMAPL137 platforms

### 10.6.1 Changes from previous release (Version 01.30.00.02)

- 1) This is an engineering release as part of the combined support for OMAPL137, C6747, C6748 and OMAPL138.
- 2) The Licensing scheme for BIOSPSP package has been changed from "TI Proprietary" to "new BSD".
- 3) Please see the "Fixed in this release" for details on IR's fixed/implemented

### 10.6.2 Known Issues

#### 10.6.2.1 MISRA C

- MISRA C check has not been run on all the components in this release.

#### 10.6.2.2 Instrumentation (all components)

- Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation. **CQ SDOCM00051988**

**Workaround:** None.

---

#### 10.6.2.3 LCDC Raster Controller (DSP/BIOS™) Driver

- Slight flickering is observed on the display when the image is displayed by the sample application. This issue is being analyzed. **CQ SDOCM00055419**

**Workaround:** None

#### 10.6.2.4 UART (DSP/BIOS™) Driver

- The write from the UART to the serial console fails at 2400 baud in interrupt mode. This issue is being analyzed. **CQ SDOCM00058955**

**Workaround:** Use DMA or polled mode for data transfer

- When the RXFIFO threshold is greater than 4 and the baudrate is greater than or equal to 115200 baud, data received contains repeated characters and does not match the transmitted characters. This issue is being investigated. **CQ SDOCM00059982**

**Workaround:** Use polled or interrupt mode of operation.

#### 10.6.2.5 McASP (DSP/BIOS™) Driver

- The start and stop IOCTLs are not working as expected. The audio does not appropriately stop and restart at the issue of these commands. This issue is being investigated. **CQ SDOCM00059968**
- The IOCTLs for MUTE and Un-MUTE are not working as expected. The audio does not appropriately mute and restart at the issue of these commands. This issue is being investigated. **CQ SDOCM00059969**
- The IOCTL commands are not tested in non-loopjob mode,. This will be taken up in forthcoming releases. **CQ SDOCM00059895**
- The driver is not working as expected in non-loopjob mode. Data loss is observed in some cases. This issue is being investigated. **CQ SDOCM00059897**
- The cache settings for audio sample application need changes to improve the performance of audio sample application. Currently, the L2 cache is not being used and the external memory is not placed as cache-able memory. **CQ: SDOCM00060198**

### 10.6.3 Limitations

#### 10.6.3.1 I2C (DSP/BIOS™) Device Driver

- Loopback is not supported in interrupt mode
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMR register)
- I2C driver does not support slave mode of operation in polled mode. Only interrupt and DMA interrupt mode of operation are supported. The slave mode of operation is tested successfully 100,200 and 400 kHz I2C clock frequency.
- (a) I2C slave application need to take care of the data (application level) protocol on when and what to receive and send by/from slave side. (b) This driver provides a generic bus communication path for slave. (c) Application protocol also needs to consider the latency caused by software slave implementation. (d) The driver

does not support "0" no of byte transfer and the slave driver would not function properly if master issues a STOP condition immediately after a START condition.

#### 10.6.3.2 *SPI (DSP/BIOS™) Device Driver*

- Slave mode of operation is tested at 2MHz. Because of the wired EVM to EVM connectivity, signal integrity was not good to test on further higher frequencies.
- (a) Application protocol also needs to consider the latency caused by software slave implementation. (b) The driver does not support "0" no of byte transfer.

#### 10.6.3.3 *McASP (DSP/BIOS™) Device Driver*

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

#### 10.6.3.4 *Aic3106 Codec driver (DSP/BIOS™)*

The Aic31 driver currently supports only one codec instance.

#### 10.6.3.5 *EVM OMAPL137 Limitation*

- None

### 10.6.4 Fixed in this release

#### 10.6.4.1 *SPI (DSP/BIOS™) Driver*

- **CQ SDOCM00059965:** The read/write (to on board SPI flash) test would hang at 50MHz. This was because the IOP would not be returned to the application in case of errors. This has been corrected.
- **CQ SDOCM00059026:** Cancel pending IOCTL would fail to return to the application in all modes. This was because the status to the GIOlayer was being sent as completed, though it was being queued and actually pending to be completed. This would result in the IOP packet being reused and corrupting the queue maintained by the driver. This has been corrected.

#### 10.6.4.2 *UART (DSP/BIOS™) Driver*

- **CQ SDOCM00060094:** Some of the IOCTL commands would result in failure because the mdControlChan function would check command arguments against NULL even if command argument would be NULL by requirement –example command to reset TX/RX FIFO. This has been corrected and only in valid cases command arguments are checked for NULL

## 10.7 Release 01.30.00.02

This was the first release with combined support for C6748, C6747, OMAPL137 and OMAPL138

### 10.7.1 Changes from previous release (Version 01.20.00 GA)

- 1) This is an engineering release as part of the combined support for OMAPL137, C6747, C6748 and OMAPL138.
- 2) The UART driver EDMA programming has been now changed to AB-Sync mode and as a result a new parameter has been added to the device parameters

(instance parameters). Please refer to the UART section of User guide for more details

- 3) The GPIO Chip Select feature implementation of SPI driver has undergone changes. This is to include provision for using more than on GPIO as Chip selecte. The instance parameters and the I/O request (submit time) parameters have undergone changes. Please refer to the SPI section of User guide for more details.
- 4) Please see the "Fixed in this release" for details on IR's fixed/implemented

## 10.7.2 Known Issues

### 10.7.2.1 MISRA C

- MISRA C check has not been run on all the components in this release.

### 10.7.2.2 Instrumentation (all components)

- Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation. **CQ SDOCM00051988**

**Workaround:** None.

### 10.7.2.3 LCDC Raster Controller (DSP/BIOS™) Driver

- Slight flickering is observed on the display when the image is displayed by the sample application. This issue is being analyzed. **CQ SDOCM00055419**

**Workaround:** None

### 10.7.2.4 Instrumentation (all components)

- Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation. **CQ SDOCM00051988**

**Workaround:** None.

### 10.7.2.5 UART (DSP/BIOS™) Driver

- The write from the UART to the serial console fails at 2400 baud in interrupt mode. This issue is being analyzed. **CQ SDOCM00058955**

**Workaround:** Use DMA or polled mode for data transfer

- When the RXFIFO threshold is greater that 4 and the baudrate is greater than or equal to 115200 baud, data received contains repeated characters and does not match the transmitted characters. This issue is being investigated. **CQ SDOCM00059982**

**Workaround:** Use polled or interrupt mode of operation.

### 10.7.2.6 McASP (DSP/BIOS™) Driver

- The start and stop IOCTLs are not working as expected. The audio does not appropriately stop and restart at the issue of these commands. This is issue is being investigated. **CQ SDOCM00059968**

- The IOCTLs for MUTE and Un-MUTE are not working as expected. The audio does not appropriately mute and restart at the issue of these commands. This issue is being investigated. **CQ SDOCM00059969**
- The IOCTL commands are not tested in non-loopjob mode,. This will be taken up in forthcoming releases. **CQ SDOCM00059895**
- The driver is not working as expected in non-loopjob mode. Data loss is observed in some cases. This issue is being investigated. **CQ SDOCM00059897**

#### 10.7.2.7 *SPI (DSP/BIOS™) Driver*

- Cancel pending IOCTL fails to return to the application in all modes. This issue is being analyzed. **CQ SDOCM00059026**

### 10.7.3 Limitations

#### 10.7.3.1 *I2C (DSP/BIOS™) Device Driver*

- Loopback is not supported in interrupt mode
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMR register)
- I2C driver does not support slave mode of operation in polled mode. Only interrupt and DMA interrupt mode of operation are supported. The slave mode of operation is tested successfully 100,200 and 400 kHz I2C clock frequency.
- (a) I2C slave application need to take care of the data (application level) protocol on when and what to receive and send by/from slave side. (b)This driver provides a generic bus communication path for slave. (c) Application protocol also needs to consider the latency caused by software slave implementation. (d) The driver does not support "0" no of byte transfer and the slave driver would not function properly if master issues a STOP condition immediately after a START condition.

#### 10.7.3.2 *SPI (DSP/BIOS™) Device Driver*

- Slave mode of operation is tested at 2MHz. Because of the wired EVM to EVM connectivity, signal integrity was not good to test on further higher frequencies.
- (a) Application protocol also needs to consider the latency caused by software slave implementation. (b) The driver does not support "0" no of byte transfer.

#### 10.7.3.3 *McASP (DSP/BIOS™) Device Driver*

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

#### 10.7.3.4 *Aic3106 Codec driver (DSP/BIOS™)*

The Aic31 driver currently supports only one codec instance.

#### 10.7.3.5 *EVM OMAPL137 Limitation*

None

---

**10.7.4 Fixed in this release****10.7.4.1** *BLOCK MEDIA (DSP/BIOS™) Driver*

- **CQ SDOCM00056769:** Block media driver SET\_RAW\_DEVICE IOCTL would fail if called multiple times. This was because once the RAW device is set, setting it again would return failure values. However, this has been corrected and now it would return success.

**10.7.4.2** *Audio Interface (DSP/BIOS™) Driver*

- **CQ SDOCM00057452:** Critical section protection was not implemented properly during channel creation and return values were not handled properly during channel deletion. These are corrected.

**10.7.4.3** *McASP (DSP/BIOS™) Driver*

- **CQ SDOCM00057459:** The interrupt registration in McASP was improper. Wrong combination of event/hwi number and ECM/Interrupt enable APIs were used. This has been corrected.
- **CQ SDOCM00057627:** The loop job buffer size has been reduced by managing the loop job buffers with better parameter and options for EDMA.

**10.7.4.4** *McASP (DSP/BIOS™) Driver*

- **CQ SDOCM00059786:** McBSP device deletion was failing because the instance number was wrongly updated to -1 before freeing the instance. This has been corrected.
- **CQ SDOCM00059787:** McBSP device deletion would fail because the associated channel states were not updated properly. This has been corrected.

**10.7.4.5** *AIC3106 (DSP/BIOS™) Driver*

- **CQ SDOCM00057467:** The default parameters for codec were using wrong value for slot width. It was 16 instead of using slotwidth enumeration. This has been corrected.

**10.7.4.6** *SPI (DSP/BIOS™) Driver*

- **CQ SDOCM00057735:** The NULL condition check was for output buffer only. This has been corrected to include check for both INPUT and OUTPUT buffer NULL condition

**10.7.4.7** *I2C (DSP/BIOS™) Driver*

- **CQ SDOCM00057837:** The NULL check for packet during submits was made in case of FLUSH and ABORT commands also. However, this will actually be NULL for these commands and hence should not be checked. This has been corrected.
- **CQ SDOCM00058010:** The user supplied EDMA event queues were being overwritten. This has been corrected.
- **CQ SDOCM00058047:** The default number of channels for the driver has been increased from 2 to 5.
- **CQ SDOCM00059530:** The module input clock frequency for I2C 0 instance were wrongly based at 50 MHz. This has been corrected to 24MHz.



#### 10.7.4.8 *UART (DSP/BIOS™) Driver*

- **CQ SDOCM00057984:** The NULL condition check for parameters in uart read and writes functions have been corrected.
- **CQ SDOCM00058384:** The UART FIFO needs to be re-enabled in case of EDMA miss errors to re-generate the missed event. The steps followed were wrong and this has been corrected.

#### 10.7.4.9 *Register CSL*

- **CQ SDOCM00059240:** As part of having a common code base for OMAPL137, C6747, C6748 and OMAPL138 following changes have effected:-
  - Macros for number of banks and pins for GPIO has been moved to SoC file from GPIO header file.
  - In cslr\_edma3cc.h The reserved bytes at the end of EDMA3CC register overlay had been changed
  - cslr\_spi.h file has included changes for multiple chipselects
  - cslr\_pll.c will now be cslr\_pll\_<soc>.h

cslr\_intc.h will now be cslr\_dspintc.h. Also, the macros inside the file will now contain DSPINTC instead of INTC

## 10.8 Release 01.20.00

This was the GA release for OMAPL137

### 10.8.1 Known Issues

#### 10.8.1.1 *Instrumentation (all components)*

- Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation. **CQ SDOCM00051988**

**Workaround:** None.

#### 10.8.1.2 *LCDC Raster Controller (DSP/BIOS™) Driver*

- Slight flickering is observed on the display when the image is displayed by the sample application. This issue is being analyzed. **CQ SDOCM00055419**

**Workaround:** None

### 10.8.2 Limitations

#### 10.8.2.1 *I2C (DSP/BIOS™) Device Driver*

- Loopback is not supported in interrupt mode
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMR register)
- I2C driver does not support slave mode of operation in polled mode. Only interrupt and DMA interrupt mode of operation are supported. The slave mode of operation is tested successfully 100,200 and 400 kHz I2C clock frequency.

- (a) I2C slave application need to take care of the data (application level) protocol on when and what to receive and send by/from slave side. (b) This driver provides a generic bus communication path for slave. (c) Application protocol also needs to consider the latency caused by software slave implementation. (d) The driver does not support "0" no of byte transfer and the slave driver would not function properly if master issues a STOP condition immediately after a START condition.

#### 10.8.2.2 *SPI (DSP/BIOS™) Device Driver*

- Slave mode of operation is tested at 2MHz. Because of the wired EVM to EVM connectivity, signal integrity was not good to test on further higher frequencies.
- (a) Application protocol also needs to consider the latency caused by software slave implementation. (b) The driver does not support "0" no of byte transfer.

#### 10.8.2.3 *UART (DSP/BIOS™) Device Driver*

- UART Baud rates greater than 115200 are not supported. This is due to high error percentage observed for baud rates greater than 115200. Please refer UART datasheet sprufm6, section 2.1 (Table 1) for more details.

#### 10.8.2.4 *McASP (DSP/BIOS™) Device Driver*

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

#### 10.8.2.5 *Aic3106 Codec driver (DSP/BIOS™)*

The Aic31 driver currently supports only one codec instance.

#### 10.8.2.6 *EVMOMAPL137 EVM Limitation*

None

### 10.8.3 Fixed in this release

#### 10.8.3.1 *AIC3106 Codec (DSP/BIOS™) Device Driver*

- **CQ SDOCM00056129** – Codec driver repeated device creation and deletion calls would fail. This was due to a null pointer dereference in the device deletion function of the driver. This has been corrected.

**File modified:** Aic31.c

#### 10.8.3.2 *McASP (DSP/BIOS™) Device Driver*

- **CQ SDOCM00055498** – McASP driver had a redundant EDMA3 enable transfer call in the submit path, when the packet was the very first one to be queued to the driver. This would result in the EDMA events being missed and thus result in errors in the McASP in a specific (corner) condition. This has been removed and the issue is fixed.

**File modified:** Mcasp.c

## 10.9 Release 01.20.00.08

The release 01.20.00.08 was an internal release for OMAPL137

---

## 10.9.1 Known Issues

### 10.9.1.1 Instrumentation (all components)

- Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation. **CQ SDOCM00051988**

**Workaround:** None.

### 10.9.1.2 LCDC Raster Controller (DSP/BIOS™) Driver

- Slight flickering is observed on the display when the image is displayed by the sample application. This issue is being analyzed. **CQ SDOCM00055419**

**Workaround:** None

## 10.9.2 Limitations

### 10.9.2.1 I2C (DSP/BIOS™) Device Driver

- Loopback is not supported in interrupt mode
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMR register)

### 10.9.2.2 UART (DSP/BIOS™) Device Driver

- UART Baud rates greater than 115200 are not supported. This is due to high error percentage observed for baud rates greater than 115200. Please refer UART datasheet sprufm6, section 2.1 (Table 1) for more details.

### 10.9.2.3 McASP (DSP/BIOS™) Device Driver

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

### 10.9.2.4 Aic3106 Codec driver (DSP/BIOS™)

- The Aic31 driver currently supports only one codec instance.

### 10.9.2.5 EVMOMAPL137 EVM Limitation

- None

## 10.9.3 Fixed in this release

### 10.9.3.1 MISRA C

MISRA C compliance has been checked in all the driver modules. The violations/errors have been fixed, with some waivers and exceptions.

### 10.9.3.2 Message logging

- **CQ: SDOCM00053558** – The sample applications did not have a uniform method of logging. This has been now made uniform across all sample applications to use DSP/BIOS™ message logging, using log trace objects.

---

**10.9.3.3** *CSL functions*

- **CQ: SDOCM00054890** – The CSL function macros (like CSL\_Fxxx) are replaced with direct operations using CSL macros in order to increase the clarity and ready readability of the operation.

**10.9.3.4** *IOM\_FLUSH handling*

- **CQ: SDOCM00050527** – IOM\_FLUSH command handling in submit function has been implemented in all the drivers

**10.9.3.5** *SPI (DSP/BIOS™) Device Driver*

- **CQ: SDOCM00052636** – The SPI sample application failed when the SDRAM was configured be used for heap memory allocations. This issue was due to wrong pinmuxing, where the EMIF pinmux settings were masked out (EMIF and SPI share same pinmux register). This has been corrected.

**Files Modified:** spi\_evmInit.c

- **CQ: SDOCM00053810** - The pin configuration register is used to configure the functionality if the CS0 pin to be either GPIO or a chip select. However, care was not taken to check the pin mode (3/4/5) while setting this and the driver would always configure CS0 pin as CS. This would cause inter-operability issues when the driver is in 3-pin mode where CS0 is not used and hence the user could not use it as a GPIO. This has been corrected.

**Files Modified:** Spi.c

- **CQ: SDOCM00054146** – The SPI sample application would fail at frequencies lower than 5MHz in EDMA mode of operation. This was due to a race condition in EDMA callback handling. This has been corrected.

**Files Modified:** Spi\_edma.c

- **CQ: SDOCM00050609** – The sample application failed in release mode for data comparison. This was due to a race condition from improper handling of CS logic. This has been corrected.

**Files Modified:** Spi.c

- **CQ: SDOCM00053787**– The SPI sample application would fail for some sectors of the flash. This was due to a race condition in from the improper handling of CS logic. This has been corrected.

**Files Modified:** Spi.c

**10.9.3.6** *I2C (DSP/BIOS™) Device Driver*

- **CQ: SDOCM00050948** – The requirement for I2C sample application stated that it would interact with on board codec. However, the sample application is interacting with the on board EEPROM. The requirement document has been corrected.

**Files Modified:** None.

- **CQ: SDOCM00052224** – During instance deletion, delete function would not check if all the channels opened on it are closed and would directly delete the instance. This would result in unpredictable behavior. This has been corrected. Also, in during channel creation, in channel create function, interrupts were

disabled during channel initialization, however were not restored before return in case of an error. This would result in a system hang. This has been corrected

**Files Modified:** I2c.c.

#### 10.9.3.7 *UART (DSP/BIOS™) Device Driver*

- **CQ: SDOCM00053642** – The instance state was changed to “deleted” in channel close function. This was an error since the instance could have multiple channels and also, the instance state should only be changed in instance create/delete functions, after checking if the channels are all closed in this instance. This has been corrected

**Files Modified:** Uart.c

- **CQ: SDOCM00053643** – The status variable in instance delete function of the UART driver was not handled properly and hence the instance deletion would be notified as failed, though no error had actually occurred. This has been corrected.

**Files Modified:** Uart.c

- **CQ: SDOCM00053645** – After the power and emulation bits in the UART are changed in the PWREMU register, during instance creation, a small delay is given for the changes to take effect. This delay was provided by means of putting the task, calling the creation, to sleep (TSK\_sleep(...)). However, during the dynamic creation call (DEV\_createDevice(...)) the interrupts are disabled and hence the task would never return from sleep (as the scheduler does not run). This would cause a hang. This has been circumvented now by including a busy while-wait loop.

**Files Modified:** Uart.c

#### 10.9.3.8 *GPIO (DSP/BIOS™) Driver*

- **CQ: SDOCM00048745** – Though the rising or falling edge only interrupt is enabled, the interrupts would arrive at both the edges from the pin. This was not a pin/bank configuration problem, but due to significant signal bounce at the pin when the switches are toggled. Thus to circumvent this, a “delay loop and read state” is employed in the application registered GPIO ISR to ward-off the spurious interrupts.

**Files Modified:** gpio\_Sampleio.c

- **CQ: SDOCM00054889** – The pin number supplied by the application for any pin operation starts from “1”, going by the GPIO User’s Guide. However, the GPIO driver maintains the information of the pins/banks in array and hence the index would start from “0”. Thus the driver should decrement the pin number by one and update the array of information internally. This has been implemented.

**Files Modified:** Gpio.c

#### 10.9.3.9 *McASP (DSP/BIOS™) Driver*

- **CQ: SDOCM00055007** – The McASP IOCTL for mute on was not taking effect since the IOCTL command value comparison in the IOCTL function was incorrect. This has been corrected.

**Files Modified:** Mcasp.c

- **CQ: SDOCM00055011**– The interrupts were not disabled in the channel delete function before the state change causing flood of underflow error interrupts and the driver would hang. This has been corrected.

**Files Modified:** Mcasp.c

- **CQ: SDOCM00052890**– The sample rate change IOCTL was not supported in previous releases. The support has been added in this release.

**Files Modified:** Mcasp.c

#### 10.9.3.10 AIC31 Codec (DSP/BIOS™) Driver

- **CQ SDOCM00055008** – Codec channel deletion would fail since the channel state comparison in channel delete function was incorrect. This has been corrected.

**Files Modified:** Aic31.c

### 10.10 Release 01.20.00.07

The release 01.20.00.07 was the BETA release for OMAPL137

#### 10.10.1 Known Issues

##### 10.10.1.1 MISRA C (All components)

- MISRA C check was not run on the code base as we had issues in running MisraC tools on this package. Tool had issues to scan the xdc based header files and we are currently working on it). **CQ SDOCM00052184**

**Workaround:** None.

##### 10.10.1.2 Instrumentation (all components)

- Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation. **CQ SDOCM00051988**

**Workaround:** None.

##### 10.10.1.3 SPI (DSP/BIOSTM)

- IOM\_FLUSH packet command is not supported by IOM drivers. **CQ: SDOCM00050527.**

**Workaround:None.**

- Slave mode is not tested, due to absence of on-board SPI master. The plan is to test the slave mode using board to board communication in future releases. **CQ SDOCM00048829**

**Workaround:** None.

- The SPI Sample application does not work when built in release profile. **CQ: SDOCM00050609**

**Workaround:** None

- Use of GPIO pin as SPI Chip select is not tested, due to absence of on-board test point for SPI CS pin. **CQ: SDOCM00048831**

---

**Workaround: None****10.10.1.4 I2C (DSP/BIOSTM)**

- Slave mode is not tested, due to absence of on-board I2C master. The plan is to test the slave mode using board to board communication in future releases. **CQ SDOCM00048829**

**Workaround:** None.

- I2C Driver Deviation from RDD. The RDD mentions that the I2C sample application will read/write to the AIC31 codec, however it is now working with the on board EEPROM. At the time of writing of the RDD the schematics did not show EEPROM on the board and hence the scenario of AIC31 was used. Since, now it contains the EEPROM the sample application has been changed to use EEPROM, as it makes the sample application easier to understand. The RDD therefore needs to be modified to reflect the change in the sample application. **CQ: SDOCM00050948**

**Workaround:** None

- Code review comments. The I2c\_Init () function needs to check for multiple calls. **CQ: SDOCM00052224.**

**Workaround:** None**10.10.1.5 UART (DSP/BIOSTM)**

- UART Hardware flow control is not tested. This test is planned for future release. **CQ SDOCM00048830**

**Workaround:** None.**10.10.1.6 McASP (DSP/BIOS™)**

- The audio output contains noise at increased input (to the board) audio volume levels. **CQ SDOCM00053555**

**Workaround:** Adjust input volume to the board to optimum levels

- Audio Sample Rate selection IOCTL is not implemented for McASP in Master mode. **CQ SDOCM00052890.**

**Workaround:** None.**10.10.1.7 MMCS D (DSP/BIOS™)**

- The instrumentation for MMCS D is not working. The code inside the instrumentation macro "MMCS D\_INSTRUMENTATION\_ENABLED" is just a place holder for the code being there but is not implemented and is not working. User should not enable this macro.

**10.10.1.8 NAND (DSP/BIOS™)**

- The instrumentation for NAND is not working. The code inside the instrumentation macro "NAND\_INSTRUMENTATION\_ENABLED" is just a place holder for the code being there but is not implemented and is not working. User should not enable this macro.

---

#### 10.10.1.9 *Block Media (DSP/BIOS™)*

- The instrumentation for Block media is not working. The code inside the instrumentation macro "BLKMEDIA\_INSTRUMENTATION\_ENABLED" is just a place holder for the code being there but is not implemented and is not working.

#### 10.10.1.10 *LCDC Raster Controller Driver (DSP/BIOS™)*

- It is sometimes observed that the I2C Expander setting function in the evmInit library for LCDC hangs intermittently **CQ SDOCM00053541**

**Workaround:** Power off the board. Plug out the UI board and plug in the UI board and power on the board

### 10.10.2 Limitations

#### 10.10.2.1 *I2C (DSP/BIOS™) Device Driver*

- Loopback is not supported in interrupt mode
- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMDR register)

#### 10.10.2.2 *UART (DSP/BIOS™) Device Driver*

- UART Baud rates greater than 115200 are not supported. This is due to high error percentage observed for baud rates greater than 115200. Please refer UART datasheet sprufm6, section 2.1 (Table 1) for more details.

#### 10.10.2.3 *McASP (DSP/BIOS™) Device Driver*

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

#### 10.10.2.4 *Aic3106 Codec driver (DSP/BIOS™)*

- The Aic31 driver currently supports only one codec instance.

#### 10.10.2.5 *EVMOMAPL137 EVM Limitation*

- None

### 10.10.3 Fixed in this release

- The artifacts observed in the image displayed by the LCDC raster sample application were corrected. **CQ SDOCM00053539**

### 10.11 Release 01.20.00.06

The release 01.20.00.06 was consumed internally and was not an external release.

### 10.12 Release 01.20.00.05

This was the BETA release for OMAPL137.



---

**10.12.1 Known Issues****10.12.1.1 MISRA C (All components)**

- MISRA C check was not run on the code base as we had issues in running MisraC tools on this package. Tool had issues to scan the xdc based header files and we are currently working on it). **CQ SDOCM00052184**

**Workaround:** None.

**10.12.1.2 Instrumentation (all components)**

- Instrumentation code is not yet implemented. However, the project files for iDebug and iRelease (instrumentation enabled libraries) contain xxx\_DEBUGPRINT\_ENABLE macro, which is just a place holder for further implementation. **CQ SDOCM00051988**

**Workaround:** None.

**10.12.1.3 SPI (DSP/BIOS™)**

- IOM\_FLUSH packet command is not supported by IOM drivers. **CQ: SDOCM00050527.**

**Workaround:None.**

- Slave mode is not tested, due to absence of on-board SPI master. The plan is to test the slave mode using board to board communication in future releases. **CQ SDOCM00048829**

**Workaround:** None.

- The SPI Sample application does not work when built in release profile. **CQ: SDOCM00050609**

**Workaround:** None

- Use of GPIO pin as SPI Chip select is not tested, due to absence of on-board test point for SPI CS pin. **CQ: SDOCM00048831**

**Workaround: None**

**10.12.1.4 I2C (DSP/BIOS™)**

- Slave mode is not tested, due to absence of on-board I2C master. The plan is to test the slave mode using board to board communication in future releases. **CQ SDOCM00048829**

**Workaround:** None.

- I2C Driver Deviation from RDD. The RDD mentions that the I2C sample application will read/write to the AIC31 codec, however it is now working with the on board EEPROM. At the time of writing of the RDD the schematics did not show EEPROM on the board and hence the scenario of AIC31 was used. Since, now it contains the EEPROM the sample application has been changed to use EEPROM, as it makes the sample application easier to understand. The RDD therefore needs to be modified to reflect the change in the sample application. **CQ: SDOCM00050948**

**Workaround:** None

- Code review comments. The I2c\_Init () function needs to check for multiple calls. **CQ: SDOCM00052224.**

**Workaround:** None

#### 10.12.1.5 *UART (DSP/BIOS™)*

- UART Hardware flow control is not tested. This test is planned for future release. **CQ SDOCM00048830**

**Workaround:** None.

#### 10.12.1.6 *McASP (DSP/BIOS™)*

- The audio output contains noise at increased input (to the board) audio volume levels. **CQ SDOCM00053555**

**Workaround:** Adjust input volume to the board to optimum levels

- Audio Sample Rate selection IOCTL is not implemented for McASP in Master mode. **CQ SDOCM00052890.**

**Workaround:** None.

#### 10.12.1.7 *MMCSDB (DSP/BIOS™)*

- The instrumentation for MMCSDB is not working. The code inside the instrumentation macro "MMCSDB\_INSTRUMENTATION\_ENABLED" is just a place holder for the code being there but is not implemented and is not working. User should not enable this macro.

#### 10.12.1.8 *NAND (DSP/BIOS™)*

- The instrumentation for NAND is not working. The code inside the instrumentation macro "NAND\_INSTRUMENTATION\_ENABLED" is just a place holder for the code being there but is not implemented and is not working. User should not enable this macro.

#### 10.12.1.9 *Block Media (DSP/BIOS™)*

- The instrumentation for Block media is not working. The code inside the instrumentation macro "BLKMEDIA\_INSTRUMENTATION\_ENABLED" is just a place holder for the code being there but is not implemented and is not working.

#### 10.12.1.10 *LCDC Raster Controller Driver (DSP/BIOS™)*

- It is sometimes observed that the I2C Expander setting function in the evmInit library for LCDC hangs intermittently **CQ SDOCM00053541**

**Workaround:** Power off the board. Plug out the UI board and plug in the UI board and power on the board.

### 10.12.2 Limitations

#### 10.12.2.1 *I2C (DSP/BIOS™) Device Driver*

- Loopback is not supported in interrupt mode

- In case of time bound IO requests, on timeout the driver is not able to perform any operations on the peripheral. (This peripheral limitation is documented in the technical reference manual of I2C under ICMDR register)

#### 10.12.2.2 BIOS™) Device Driver

- UART Baud rates greater than 115200 are not supported. This is due to high error percentage observed for baud rates greater than 115200. Please refer UART datasheet sprufm6, section 2.1 (Table 1) for more details.

#### 10.12.2.3 McASP (DSP/BIOS™) Device Driver

- Mcasp Driver does not support switching from DIT mode to TDM mode dynamically.

#### 10.12.2.4 Aic3106 Codec driver (DSP/BIOS™)

The Aic31 driver currently supports only one codec instance.

#### 10.12.2.5 EVMOMAPL137 EVM Limitation

None

### 10.12.3 Fixed in this release

#### 10.12.3.1 SPI (DSP/BIOS™) Device Driver

- **CQ: SDOCM00050526** - Spi edma mode example needs to be added and hence the driver still needs to be tested in edma mode. This IR is fixed in this release. The EDMA mode sample application is provided in this release for SPI driver.

**Files Modified:** spiSample\_main.c, spiSample\_io.c

- **CQ: SDOCM00049902** - SPI data transfer fails when configured for loopback in Interrupt mode. This IR is fixed in this release.

**Files Modified:** None

- **CQ: SDOCM00051114** - Spi\_IOCTL\_CANCEL\_PENDING\_IO ioctl returns failure. This IR is fixed in this release.

**Files Modified:** Spi.c.

- **CQ: SDOCM00048831** - The SPI driver need to have "use a GPIO" as chip select feature. This IR is fixed in this release.

**Files Modified:** Spi.c, Spi.h.

- **CQ SDOCM00050831** - After loading the SPI sample application program (.out) through CCS, none of the program can be loaded. This IR is fixed in this release.

**Files Modified:** spiSample\_main.c

#### 10.12.3.2 I2C (DSP/BIOS™) Device Driver

- **CQ: SDOCM00049900** - I2C Set bit rate IOCTL commands fails. This IR is fixed in this release.

**Files Modified:** I2c.c

- **CQ: SDOCM00050946** - Driver hangs for I2C write to invalid slave address in Interrupt and DMA mode. This IR is fixed in this release.

**Files Modified:** I2c.c.

- **CQ: SDOCM00050950** – code review, the driver code should return error in case of failure. This IR is fixed in this release.

**Files Modified:** I2c.c.

#### 10.12.3.3 *UART (DSP/BIOS™) Device Driver*

- **CQ: SDOCM00049903** - UART data transfer fails when configured as loopback in DMA mode. This IR is fixed in this release.

**Files Modified:** None.

- **CQ: SDOCM00050475** - UART Baud rates greater than 115200 are not supported. This IR is fixed in this release.

**Files Modified:** none. (Please refer to the section 6.3)

- **CQ: SDOCM00050477** - UART Multiple submit calls (transmit) results in failure in DMA mode. This IR is fixed in this release.

**Files Modified:** Uart\_edma.c, Uart.h.

- **IR SDOCM00050835** - UART sample application fails in interrupt mode, when a file greater than 1000 bytes is given as input. This IR is fixed in this release.

**Files Modified:** uartSample\_io.c.

- **CQ: SDOCM00052469** - OMAPL137 uart edma example Pjt file list and cmd file errors. This IR is fixed in this release.

**Files Modified:** uartSample\_Debug.cmd, uartSample.pjt

#### 10.12.3.4 *Aic3106 Codec driver (DSP/BIOS™)*

- AIC31 driver does not support more than one codec instance **CQ SDOCM00049853.**
- AIC31 driver does not support some IOCTLS **CQ SDOCM00049855.**
- The left channel of the audio output from the HP out pin is muted. **CQ SDOCM00050490.**
- Option to configure gain in the initialization parameter is not available. **CQ SDOCM00051147.**

#### 10.12.3.5 *Audio Interface driver (DSP/BIOS™)*

- The audio interface driver does not implement some IOCTLS. **CQ SDOCM00049862.**

#### 10.12.3.6 *McASP (DSP/BIOS™) Device Driver*

- Mcasp clock failure error handling is not implemented. **CQ SDOCM00049850.**
- Usage of hardware FIFO in Mcasp driver is not implemented **CQ SDOCM00049851.**
- McASP peripheral count check is wrong in the driver **CQ SDOCM00051171.**
- McASP is to be tested in master mode **CQ SDOCM00052187.**

IOCTL command for MUTE on/off is not working. **CQ SDOCM00049904**

---

## 10.13 Release 01.20.00.04

This was the EA2 release for OMAPL137.

### 10.13.1 Fixed in this release

- None.

### 10.13.2 Known Issues

#### 10.13.2.1 MISRA C (All components)

- MISRA C check was not run on the code base as we had issues in running MisraC tools on this package. Tool had issues to scan the xdc based header files and we are currently working on it). **Workaround:** None.

#### 10.13.2.2 Instrumentation (all components)

- Instrumentation code is not yet implemented

#### 10.13.2.3 SPI (DSP/BIOS™)

- SPI EDMA mode has not been tested and there is no sample application available for spi edma mode. **CQ: SDOCM00050526**  
**Workaround:** None.
- IOM\_FLUSH packet command is not supported by IOM drivers.**CQ: SDOCM00050527.**  
**Workaround:None.**
- Slave mode is not tested, due to absence of on-board SPI master. The plan is to test the slave mode using board to board communication in future releases. **CQ SDOCM00048829**  
**Workaround:** None.
- SPI driver fails in interrupt mode and configured for loopback (DLB). **CQ SDOCM00049902**  
**Workaround:** None.
- The SPI Sample application does not work when built in release profile. **CQ: SDOCM00050609**  
**Workaround:** None
- The SPI sample application IO transfer fails after usage of IOCTL\_SET\_POLLEDMODETIMEOUT ioctl call for any value of timeout. **CQ: SDOCM00051115**  
**Workaround: None**
- After loading the SPI sample application program (.out) through CCS, none of the program can be loaded. **CQ SDOCM00050831**  
**Workaround: None**

---

**10.13.2.4 I2C (DSP/BIOS™)**

- Slave mode is not tested, due to absence of on-board I2C master. The plan is to test the slave mode using board to board communication in future releases. **CQ SDOCM00048829**

**Workaround:** None.

- IOCTL command for setting the bit rate for data transfer fails. **CQ SDOCM00049900**

**Workaround:** None.

**10.13.2.5 UART (DSP/BIOS™)**

- UART driver fails in EDMA mode and configured for loopback (DLB). **CQ SDOCM00049903**

**Workaround:** None.

**10.13.2.6 McASP (DSP/BIOS™)**

- McASP FIFO support is not yet implemented and is planned for future releases. **CQ SDOCM00049851**

**Workaround:** None.

- SPDIF mode is not tested and planned for future release. **CQ SDOCM00050686**

**Workaround:** None.

- McASP clock failure error handling is not yet implemented. **CQ SDOCM00049850**

**Workaround:** None.

- IOCTL command for MUTE on/off is not working yet. This is being analyzed. **CQ SDOCM00049904**

**Workaround:** None

**10.13.2.7 Audio Interface driver (DSP/BIOS™)**

IOCTLs for the following are not yet implemented.

- Configuring the receive channel sample rate for a given Audio configuration
- Configuring the transmit channel sample rate for a given Audio configuration

**10.13.2.8 Aic3106 Codec driver (DSP/BIOS™)**

IOCTLs for the following are not yet implemented.

- Select the input Audio mode Line-In or Mic-In.
- Select the output Audio mode Line-Out or Speaker-Out

Increase or Decrease the input volume

**10.14 Release 01.20.00.03**

- This was the EA1 release for OMAPL137 that contained the rCSLs and their examples. This contained the fixes for following IRs
  - SDOCM00048718

- SDOCM00048737

**10.15 Release 01.20.00.02**

- This was the EA1 release for OMAPL137 that contained the rCSLs and their examples. This was the initial release